


N3100-9142

N Plug Crimp Right Angle

50Ω

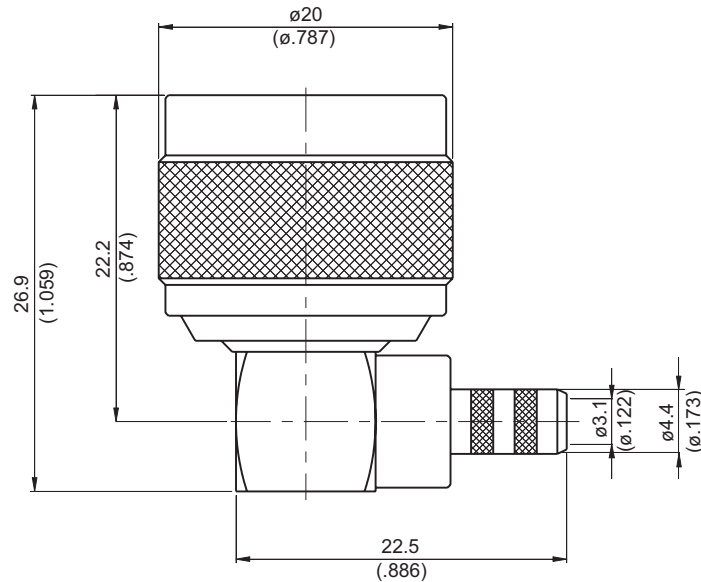

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicone	
Center Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 29.22 g


Suitable Cables: RG55, RG142, RG400, RG142-E

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N3100-9142

JYE BAO CO., LTD.

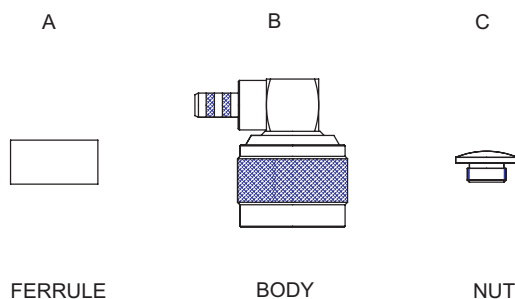


DIAGRAM


ASSEMBLY INSTRUCTION




Step 1: STRIP AS SHOWN.

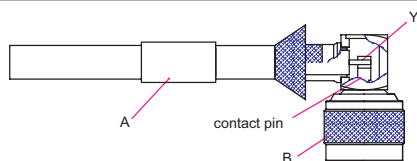

Step 2: SLIDE FERRULE "A" OVER CABLE.
Step 3: WRAP THE BRAIDING UPWARDS.
Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR "B" AND SOLDER IN 'Y'.

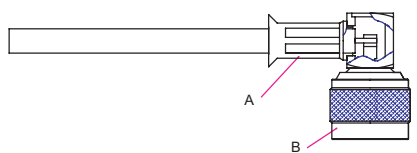

Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "B" AND CRIMP.

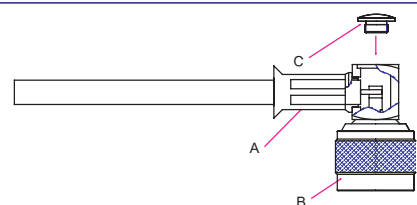

Step 6: SCREW "C" ON THE CONNECTOR.